

PSF'd
Box CR-7

(This section to be completed by subcontractor requesting document)

Requestor J. Lamb / 1034A
 Document Center (is requested to provide the following document)
 Date of request ~~5/13/96~~ 5/3/96 Expected receipt of document ~~5/13/96~~ 6/3/96
 Document number ~~none~~ K/CR-745 Date of document 1995 6/1/95
 Title and author (if document is unnumbered)
Barton, J.C. K-1004J Filter Change

(This section to be completed by Document Center)

Date request received 5/10/96
 Date submitted to ADC 5/21/96
 Date submitted to HSA Coordinator 5/10/96

(This section to be completed by HSA Coordinator)

Date submitted to CICO 5/21/96
 Date received from CICO 5/28/96
 Date submitted to ChemRisk/Shonka and DOE 5/28/96

(This section to be completed by ChemRisk/Shonka Research Associates, Inc.)

Date document received _____
 Signature _____

In Magic #2932

~~OFFICIAL USE ONLY~~

INTER-COMPANY CORRESPONDENCE

(INSERT
NAME)

COMPANY

CARBIDE AND CARBON CHEMICALS DIVISION
Union Carbide and Carbon Corporation

LOCATION

Post Office Box P
OAK RIDGE, TENN.

TO
LOCATION

Mr. D. M. Lang
Building K-1004-D

DATE June 1, 1950

ANSWERING LETTER DATE

ATTENTION

COPY TO

Mr. J. C. Barton K25RC
Dr. H. A. Bernhardt
Mr. N. Gerber
Dr. F. W. Hurd
Mr. C. A. Kienberger
Attn: Mr. S. A. Kingsbury
Mr. W. J. Wilcox

SUBJECT K-1004-J Filter Change.

K/CA-745

The outlet filter on the K-1004-J exhaust system was replaced April 14, 1950 after approximately twenty months service. This filter, constructed of forty Edgewood Arsenal filter squares arranged in eight vertical rows, was plugged to an extent which did not permit satisfactory hood face velocities.

Figure 1 shows an accumulation of dust particles on two typical squares on the upstream side of the filter. Figure 2 shows that the downstream side of the filter was virtually free from all dust. Figure 3 lists radiation measurements made by the Laboratory Radiation Detection Unit during the filter change. The maximum concentration of activity was found on the second vertical row of filters from the right on the upstream side of the filter. This row was almost directly opposite to the duct leading from the building into the filter housing. No appreciable radioactivity was found in the filter housing downstream side of the filter.

Disposal of the contaminated filter was made by burial at ORNL in a specially designed casket.

Classification changed to: UNCLAS
(date and category)
5/23/96
JCB/p
ADC signature (first reviewer)
5/23/96
ADC signature (final reviewer)
5/23/96
Date

JCB/p

This document has been reviewed for classification and has been determined to be UNCLASSIFIED.	
<i>James W. Selby</i>	ADC Signature
5/23/96	Date

J. C. Barton
J. C. Barton

Union Carbide and Carbon
Corporation, operating contractor for
the U.S. Atomic Energy Commission.

This document has been approved for release
to the public by:

John H. Hunter 5/28/96
Technical Information Officer Date
Oak Ridge K-25 Site

~~OFFICIAL USE ONLY~~

-- DECLASSIFIED --

by authority of: ~~16~~ 16- PGD-4 (K-25/LMES)

J. E. Preston, K-25 CICO 5/23/96

(Authorized Declassifier's name and organization)

J. E. Preston
(person making change)

5/28/96
(date)

James W. Hall
(Document identification verified by)

5/28/96
(date)

YTD signature (if not same) _____ Date _____

YTD or YTD signature (if not same) _____ Date _____

Comments (if any) _____
(must not exceed)




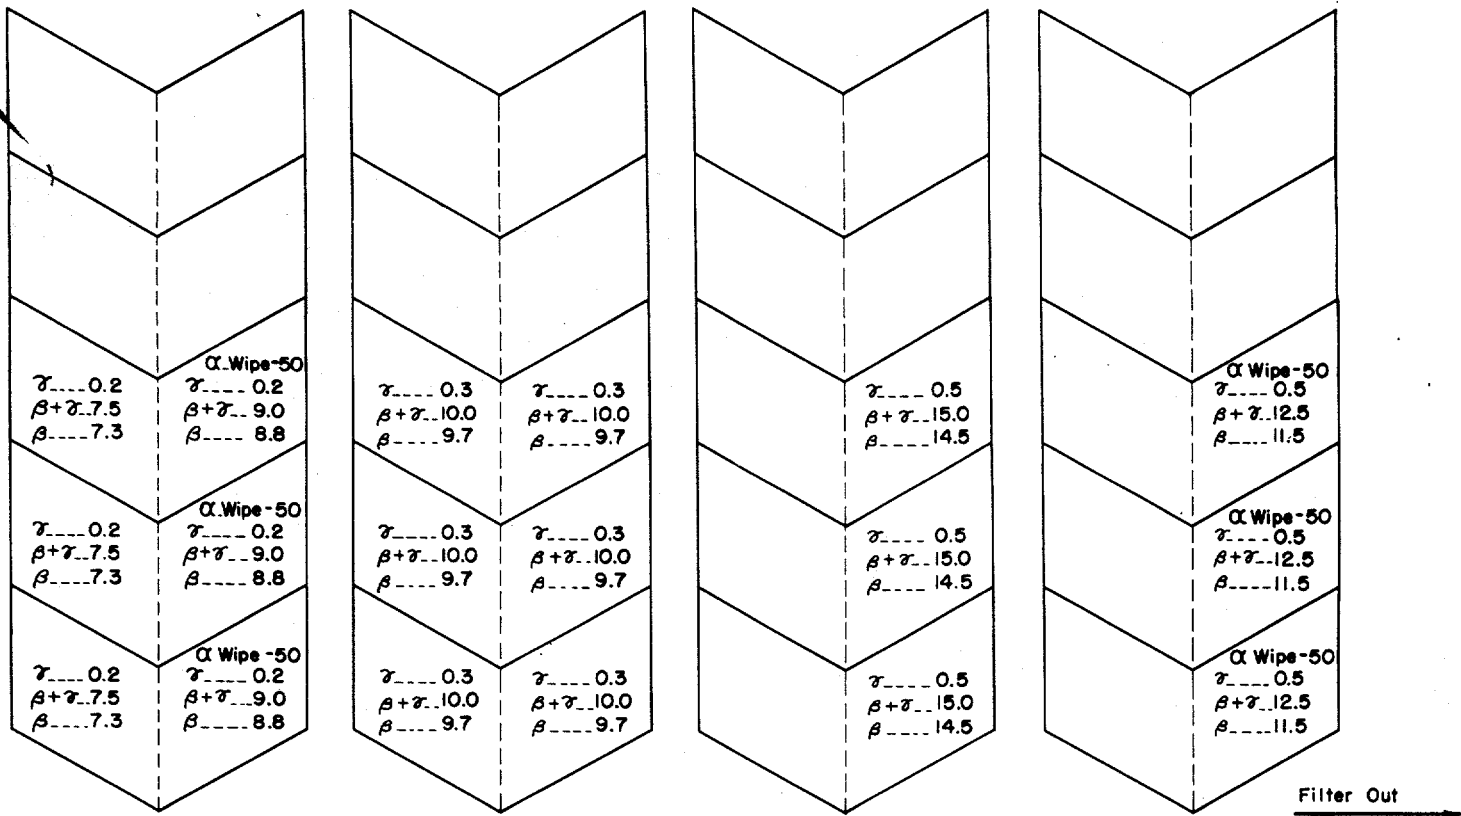
FIGURE 1
UPSTREAM SIDE OF FILTER

OFFICIAL USE ONLY


OFFICIAL USE ONLY

FIGURE 2
DOWNSTREAM SIDE OF FILTER

UPSTREAM SIDE



DOWNSTREAM SIDE

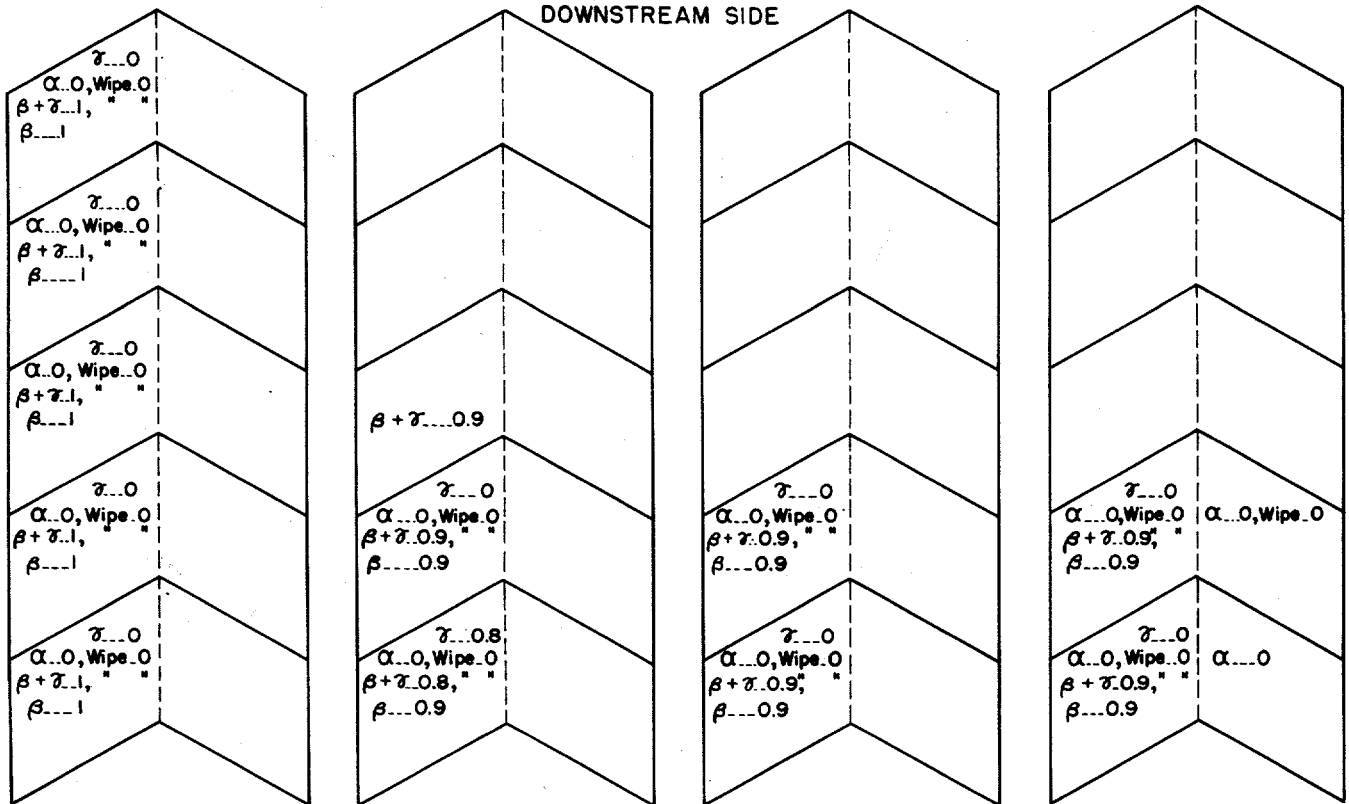

NOTES:

All β wipe test on upstream side of filter would have been positive. A part of the gamma could have been coming from the storage shed. α readings are in counts/minute. $\beta + \gamma$ readings are in mr./hr. True β reading probably less than indicated since instrument was calibrated for γ radiation.

FIGURE 3

ACTIVITY MEASUREMENTS TAKEN DURING FILTER CHANGE AT K-1004-J

(This section to be completed by subcontractor requesting document)

Requestor J. Lamb / 1034A Document Center (is requested to provide the following document)
Date of request ~~12/19/95~~ 5/3/96 Expected receipt of document ~~5/19/96~~ 6/3/96
Document number KLT-602 Date of document 6/23/50
Title and author (if document is unnumbered)

(This section to be completed by Document Center)

Date request received 5/10/96
Date submitted to ADC 5/21/96
Date submitted to HSA Coordinator 5/10/96

(This section to be completed by HSA Coordinator)

Date submitted to CICO 5/21/96
Date received from CICO 5/28/96
Date submitted to ChemRisk/Shonka and DOE 5/28/96

(This section to be completed by ChemRisk/Shonka Research Associates, Inc.)

Date document received _____
Signature _____

INTER-COMPANY CORRESPONDENCE

(INSERT NAME) COMPANY CARBIDE AND CARBON CHEMICALS DIVISION Union Carbide and Carbon Corporation LOCATION Post Office Box P
OAK RIDGE, TENN.

TO Mr. D. M. Lang
LOCATION K-1004-D

DATE June 23, 1950

ATTENTION


COPY TO

Mr. J. C. Barton
Mr. R. M. Batch
Mr. S. Cromer
Mr. N. Gerber
Dr. F. W. Hurd
Mr. C. A. Kienberger
Mr. S. A. Kingsbury ✓
Mr. R. B. Korsmeyer
Mr. S. D. Schiffman K-25RC
Dr. F. L. Steahly (ORNL)
Dr. J. A. Swartout (ORNL)
Mr. R. W. Ulm
Mr. J. L. Waters
Mr. W. J. Wilcox, Jr.

ANSWERING LETTER DATE

SUBJECT Replacement of Filter on the
K-1004-J Radiochemical
Laboratory Exhaust System

KLI-602

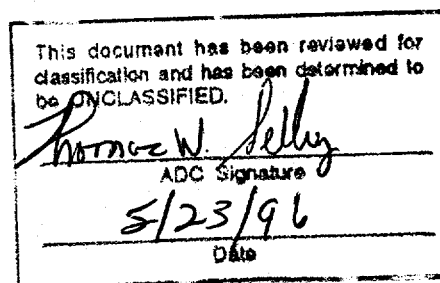

The outlet filter of the K-1004-J Radiochemical Laboratory Exhaust System, located between the laboratory and the exhaust stack, is constructed of forty, 2 ft. x 2 ft. Edgewood Arsenal filter squares arranged in eight vertical rows. After approximately twenty months service, the original filter had become plugged to the extent that satisfactory hood face velocities were unobtainable. Replacement was made April 14, 1950.

Figure 1 shows an accumulation of dust particles on two typical squares on the upstream side of the filter. Figure 2 shows that the downstream side of the filter was virtually free from all dust. Figure 3 lists radiation measurements made by the Laboratory Radiation Detection Unit during the filter change. The maximum concentration of activity was found on the second vertical row of filters from the right on the upstream side of the filter. This row was almost directly opposite to the duct leading from the building into the filter housing. No appreciable radioactivity was found in the filter housing on the downstream side of the filter.

Disposal of the contaminated filter was made by burial at ORNL in a specially designed casket.

J. C. Barton
J. C. Barton

JCB:mir

This document has been approved for release to the public by:

Don Heston 5/24/96
Technical Information Officer Date
Oak Ridge K-25 Site

Union Carbide and Carbon
Corporation, operating contractor for
the U.S. Atomic Energy Commission.

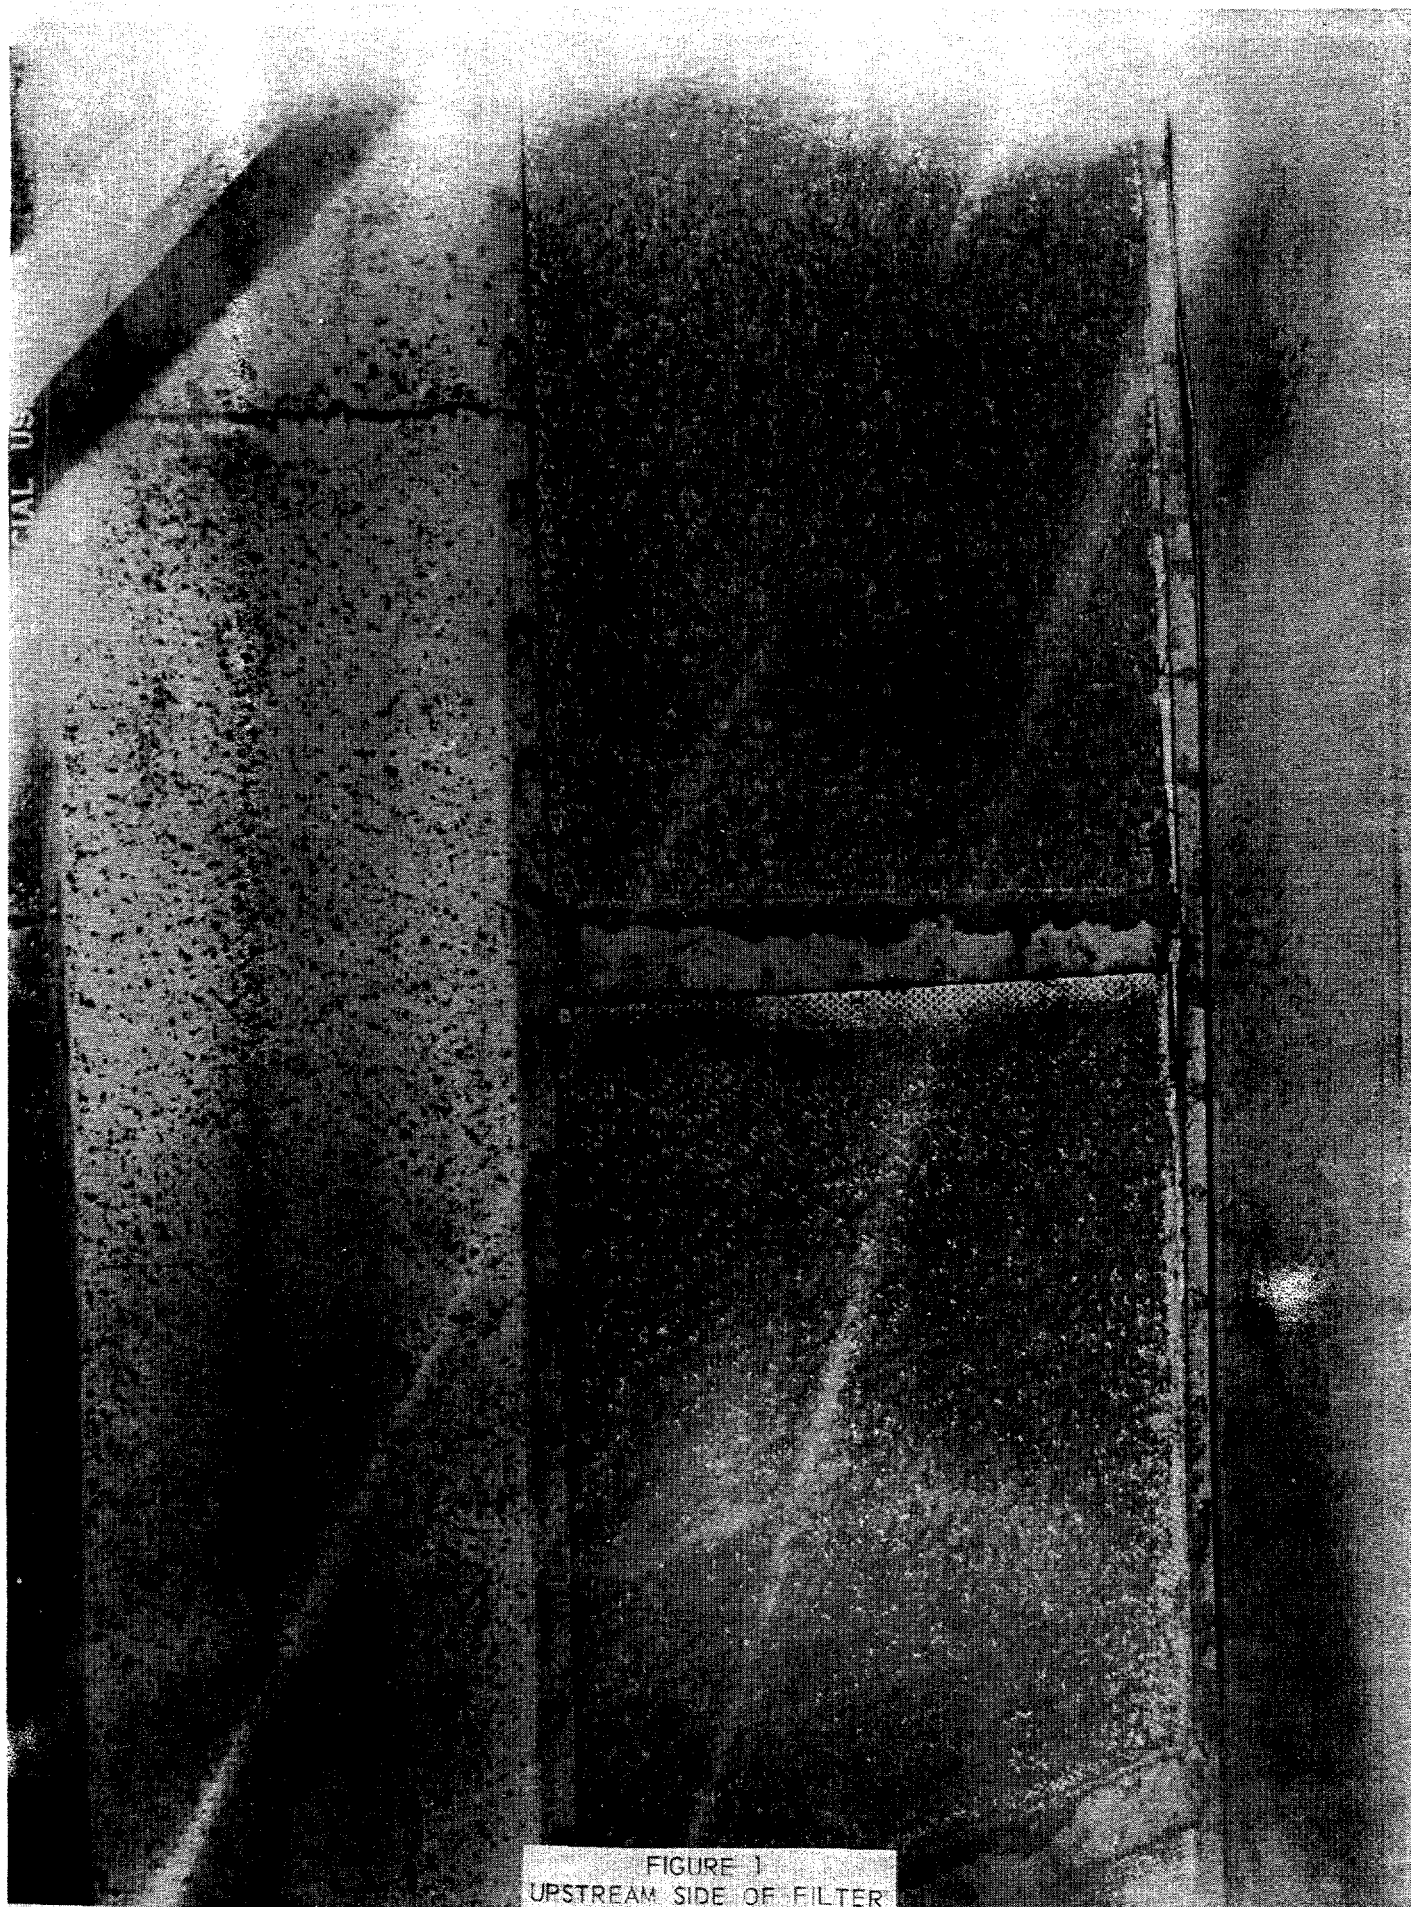


FIGURE 1
UPSTREAM SIDE OF FILTER



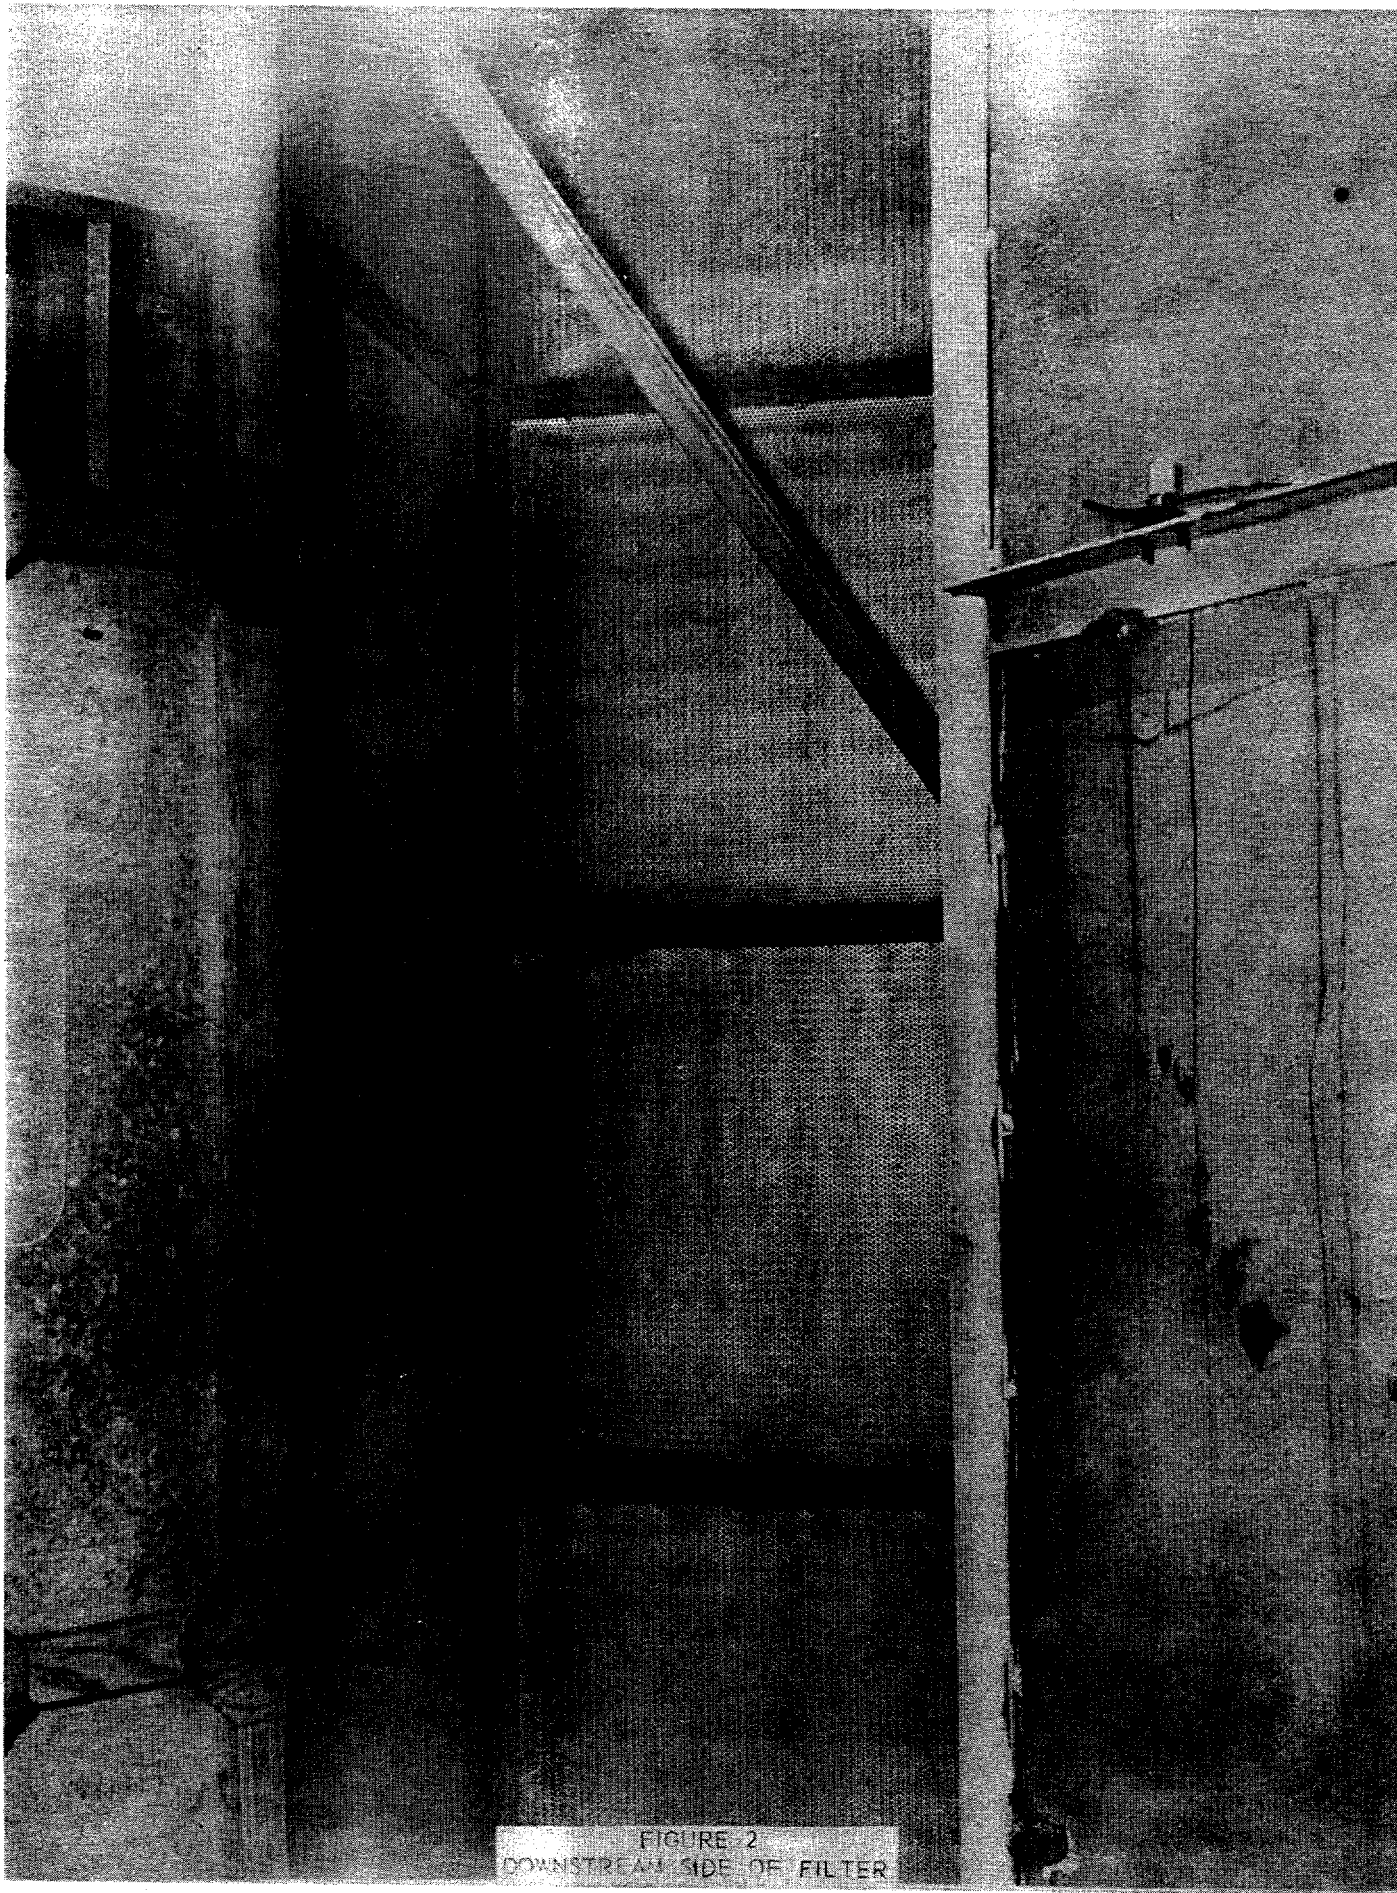


FIGURE 2
DOWNSTREAM SIDE OF FILTER

UPSTREAM SIDE

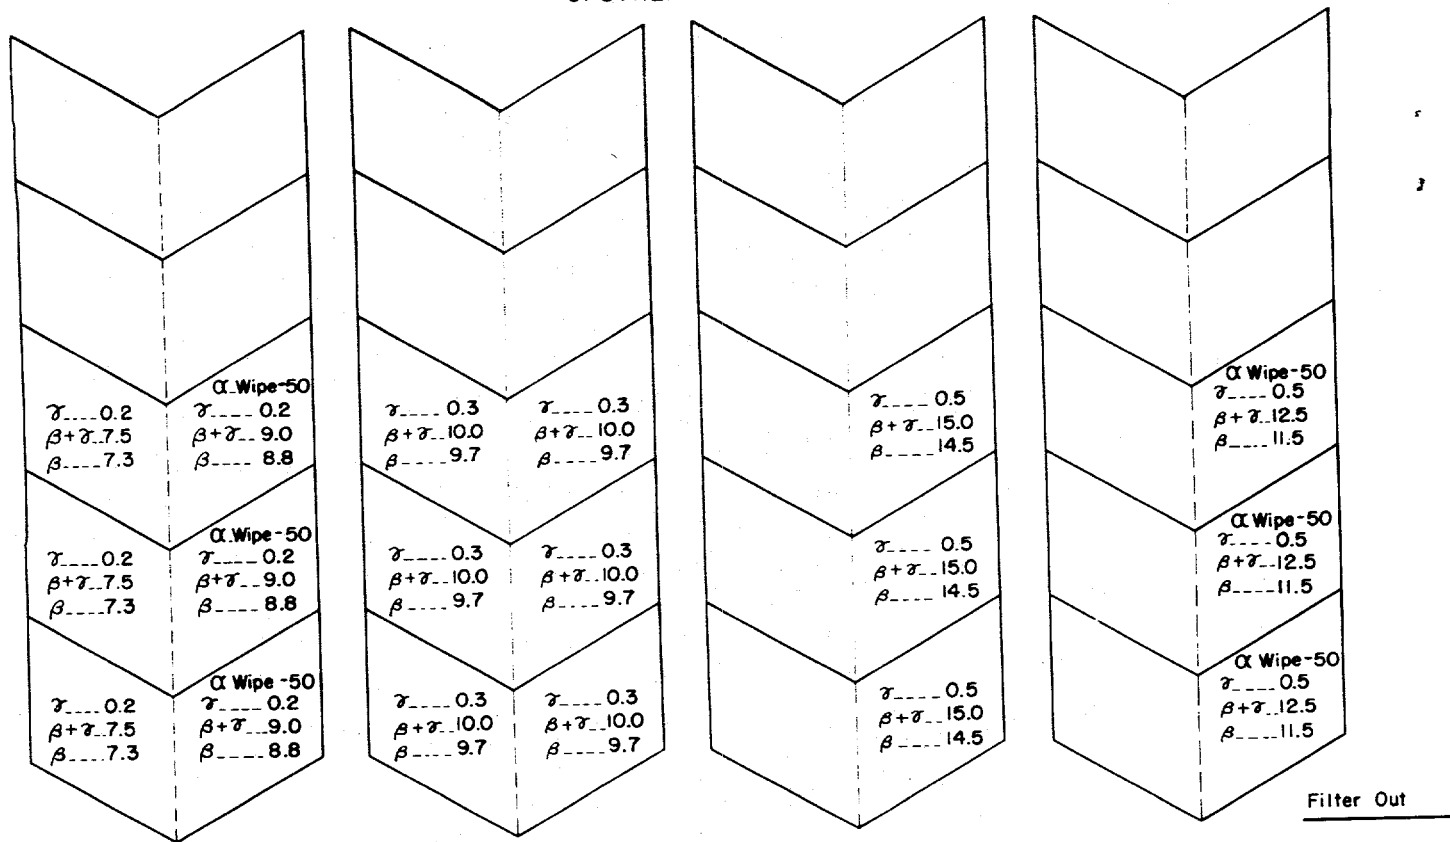

DOWNSTREAM SIDE

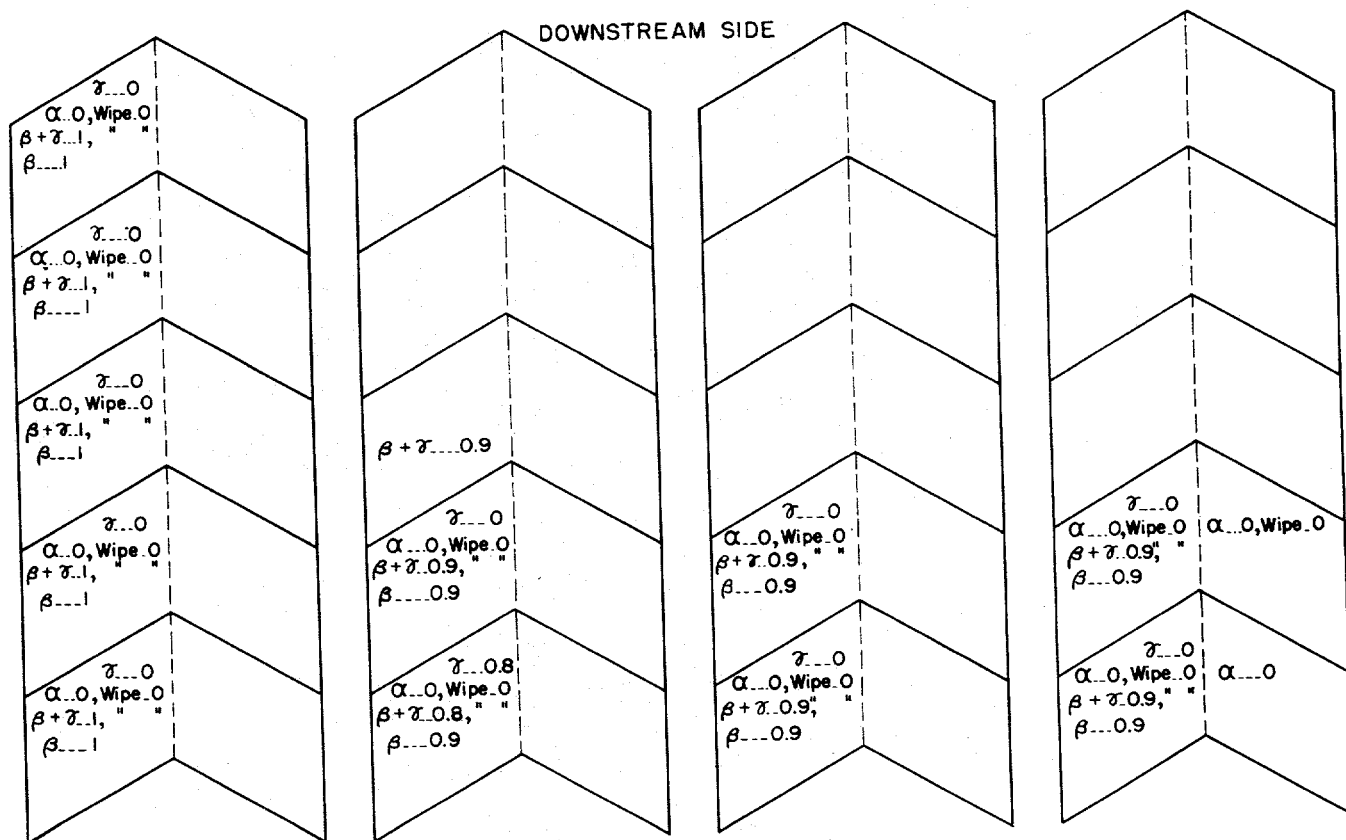

NOTES:

All β wipe test on upstream side of filter would have been positive. A part of the gamma could have been coming from the storage shed. α readings are in counts/minute. $\beta - \gamma$ readings are in mr./hr. True β reading probably less than indicated since instrument was calibrated for γ radiation.

ACTIVITY MEASUREMENTS TAKEN DURING FILTER CHANGE AT K-1004-J